

MATRIX® 908

Matrix® 908 v1.61

April 2026

Associated Documentation:

- Quick Start Guide 98-01586 R3
- User Guide 98-01578 R4
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R6

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

WARNING! v1.61 does not allow jobs created in an earlier console version to be appended. When preparing to update to v1.61, be sure that all existing jobs on the console are completed before updating.

Radion WARNING! If using Matrix 908 together with a TeeJet Radion console for coverage mapping and Automatic Section Control (ASC), the Radion console must be updated to v1.13 or later.

BoomPilot® WARNING! Do not use v1.61 with systems outside North America that include BoomPilot Automatic Section Control. Confirm compatibility with TeeJet Technical Support before using v1.61 with North American systems that include BoomPilot® Automatic Section Control.

AntiLogPro WARNING! Customers using an AntiLogPro to replay GNSS drive paths for Last Pass guidance mode demonstrations must obtain a new preloaded SD card for the AntiLogPro from TeeJet Technologies Support.

New Features:

- PDF Reports are now supported.
 - Data included in the report:
 - Job Name
 - Total Area Applied
 - Start & Stop Date(s) and Time(s)
 - Latitude & Longitude of job
 - Customer information
 - Product name, EPA registration number, Application Rate, and Total Applied for individual products
 - Target Application Rate and Total Applied for the total product mix
 - Crop, Commodity, Site Information
 - Target Pest Information
 - Application Business details
 - Applicator information
 - MetaData transfer feature allows Report Metadata to be manually entered in one console and quickly transferred by USB Drive to other consoles.
- Expands support for ISOBUS TaskStatus (TSK attribute 'G') within the TASKDATA.XML file. Now supported: Planned (1), Running (2), Paused (3), & Completed (4).
- Jobs listed in Job Manager can now be sorted in Alphabetical or Reverse Alphabetical order.

Fix:

- Multiple changes to the User Interface and system architecture to improve functionality, responsiveness, stability, and ease-of-use.

MATRIX® 908



WARNING! Several changes have been made to how job data is handled in v1.40 and later. It is **highly recommended** that all jobs created in Matrix 908 v1.31 and prior, including those created in Simple Job Mode, are exported (not simply deleted) from the console before generating new job data with v1.61 or above. Please see the Software Update Instructions bulletin 98-01577 for complete instructions on the process to export all existing job data and update to v1.61 or above.

WARNING! Software updates frequently include changes needed to support running changes to internal components in the device. New software is typically backwards compatible to older hardware, but older software often does not work on newer hardware. **DO NOT USE A PREVIOUSLY RELEASED SOFTWARE UPDATE TO ROLL CONSOLE SOFTWARE BACK TO AN EARLIER VERSION.** Contact TeeJet Customer Service or your local dealer for assistance.

WARNING! If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service **BEFORE** updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.

Matrix® 908 v1.52

August 2025

Associated Documentation:

- Quick Start Guide 98-01586 R3
- User Guide 98-01578 R4
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R6

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

Fix:

- Corrects a software build problem with v1.51 that prevented the guideline from being displayed in Last Pass guidance mode.

Radion WARNING! If using Matrix 908 together with a TeeJet Radion console for coverage mapping and Automatic Section Control (ASC), the Radion console must be updated to v1.13 or later.

AntiLogPro WARNING! Customers using an AntiLogPro to replay GNSS drive paths for Last Pass guidance mode demonstrations must obtain a new preloaded SD card for the AntiLogPro from TeeJet Technologies Support.

BoomPilot® WARNING! Do not use v1.52 with systems outside North America that include BoomPilot Automatic Section Control. Confirm compatibility with TeeJet Technical Support before using v1.52 with North American systems that include BoomPilot Automatic Section Control.

Matrix® 908 v1.51

August 2025

Associated Documentation:

- Quick Start Guide 98-01586 R3
- User Guide 98-01578 R4
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R6

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

New Features:

- Last Pass guidance mode added. Manually selected or automatically detected guidance is provided adjacent to nearby applied areas, both curved and straight. Turn radii are configurable for the machine and automatically adjust for external or internal turns and corners.
 - Supports most AutoSteer functionality.
 - Nudge is not supported for Autosteer machines while in Last Past guidance mode.
- Added compatibility with Muller Midi3 sprayer controller.

Radion WARNING! If using Matrix 908 together with a TeeJet Radion console for coverage mapping and Automatic Section Control (ASC), the Radion console must be updated to v1.13 or later.

AntiLogPro WARNING! Customers using an AntiLogPro to replay GNSS drive paths for Last Pass guidance mode demonstrations must obtain a new preloaded SD card for the AntiLogPro from TeeJet Technologies Support.

BoomPilot® WARNING! Do not use v1.51 with systems outside North America that include BoomPilot Automatic Section Control. Confirm compatibility with TeeJet Technical Support before using v1.51 with North American systems that include BoomPilot Automatic Section Control.

Fixes:

- Supported languages updated to the following: Czech, German, English, US English, Latin American Spanish, French, Italian, Polish, Brazilian Portuguese, Russian, & Ukrainian.
- Corrects problem where systems with an Application Mapping Device, or TeeJet CAN Device (including Radion), or an ISOBUS Control Function, AND FieldPilot® Pro/UniPilot® Pro may not show coverage data until an alternate device was set to Active, and then the target device set to Active again, or in the case of ISOBUS Control Functions toggling the percentage overlap to an alternate setting and back to the target setting. This process had to be executed once for each power on event.

WARNING! If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service BEFORE updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.

WARNING! Software updates frequently include changes needed to support running changes to internal components in the device. New software is typically backwards compatible to older hardware, but older software often does not work on newer hardware. **DO NOT USE A PREVIOUSLY RELEASED SOFTWARE UPDATE TO ROLL CONSOLE SOFTWARE BACK TO AN EARLIER VERSION.** Contact TeeJet Customer Service or your local dealer for assistance.

WARNING! Several changes have been made to how job data is handled in v1.40 and later. It is **highly recommended** that all jobs created in Matrix 908 v1.31 and prior, including those created in Simple Job Mode, are exported (not simply deleted) from the console before generating new job data with v1.40 or above. Please see the Software Update Instructions bulletin 98-01577 for complete instructions on the process to export all existing job data and update to v1.40 or above.

- Once the system has a GNSS position a job can now be opened without the system first detecting movement and calculating a heading. A heading is still required before the boom and Action Bar icons are available.
- Corrects problem where the system may become unresponsive when copying jobs that contain 20+ Interior boundaries.
- Corrects problem where shutting down the system while on the UT page could take 2-3 minutes.
- Changes logic with VTG message handling in systems that included FieldPilot® Pro/UniPilot® Pro, that previously compromised steering performance if the Heading Filter Strength value was high.
- Corrects problem where opening a menu page when a UT alarm is initiated may result in the system becoming unresponsive.
- Corrects problem where a system with an ISOBUS Control Function in an error state AND a FieldPilot® Pro/UniPilot® Pro displaying the Public Liability Disclosure Notice, may not allow the operator to acknowledge both pop-ups and continue with system operation.
- Corrects problem where Automatic Section Control (ASC) would errantly apply inside an Interior boundary if that boundary was not inside an Exterior boundary.
- Corrects problem where the coverage mapping may contain an errant skip soon after starting application in a job.
- Corrects problem where previously the Adjust Guideline function (sometimes referred to as A+ Move Path) could not be executed when the vehicle was moving.
- Corrects problem where boundary and guidelines were sometimes drawn defectively to the display.
- Corrects problem where completed boundaries may include a zig-zag from one boom tip to the other boom tip then back to the original boom tip again, when the boundary is closing.
- Corrects problem where coverage mapping of Application Mapping or TeeJet CAN device was slow to start in the first job after console boot.
- Corrects problem where the buttons in the Action Bar were slow to respond when in Dynamic Adaptive Curve guidance mode.
- Corrects problem where the last active Dynamic Adaptive Curve swath number is still displayed in the Guidance Bar after the Guideline has been deleted.
- Corrects problem where the search of a connected SCM Pro at console boot would sometimes terminate before the SCM Pro was discovered. The search time has increased to 120 seconds.
- Corrects problem where the Vehicle Name may not be saved and presented correctly if it contains Unicode characters.
- Corrects problem where devices that have Unicode characters in the Device Name could not be selected as the Active Device.
- Corrects problem where the boundary is deleted by the user but the boundary icon in the Status Bar indicates that the field still has a boundary.
- Multiple changes to the User Interface and system architecture to improve functionality, responsiveness, stability, and ease-of-use.
- Multiple changes in logic for Section Control State and Actual Work State for Application Mapping and TeeJet CAN devices.

Matrix® 908 v1.42

June 2024

Associated Documentation:

- Quick Start Guide 98-01586 R2
- User Guide 98-01578 R3
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R6

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

Fixes:

- Includes multiple Italian language translations that were previously missing.

WARNING! If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service **BEFORE** updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.

WARNING! Software updates frequently include changes needed to support running changes to internal components in the device. New software is typically backwards compatible to older hardware, but older software often does not work on newer hardware. **DO NOT USE A PREVIOUSLY RELEASED SOFTWARE UPDATE TO ROLL CONSOLE SOFTWARE BACK TO AN EARLIER VERSION.** Contact TeeJet Customer Service or your local dealer for assistance.

WARNING! Several changes have been made to how job data is handled in v1.40 and later. It is **highly recommended** that all jobs created in Matrix 908 v1.31 and prior, including those created in Simple Job Mode, are exported (not simply deleted) from the console before generating new job data with v1.40 or above. Please see the Software Update Instructions bulletin 98-01577 for complete

Matrix® 908 v1.41

April 2024

Associated Documentation:

- Quick Start Guide 98-01586 R2
- User Guide 98-01578 R3
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R6

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

Fixes:

- Corrects problems where systems containing jobs with many boundaries (tens) may have shut-down problems and/or the jobs may take a long time to appear in Job Manager after system boot.
- Corrects problem where the 'No GNSS' pop-up may be shown when closing an interior boundary in a job that already contains many boundaries (tens).
- Corrects problem where job data created in v1.31 or imported from an FMIS may be stored in console memory but not be shown in Job Manager.
- Corrects problem where Dynamic Adaptive Curve guidance functionality may be impeded in a new job when that new job is a copy of an existing job that has multiple guideline types.
- Buttons in the Action Bar are now disabled until the user moves the vehicle a short distance in the forward direction after the job has been opened. This movement allows the system to determine the correct location for the implement before a guideline or boundary can be created or manipulated.
- Corrects problem where it was errantly possible to restart a job that was more than one UTM zone away from the current position.
- Corrects problem where the console would errantly display an Export failed error (Error 2004) after successfully exporting all job data off the console.
- Corrects problem where the system may errantly create many single-line (shell) PFD objects in the data file when importing data sets.
- Corrects problem where the system may use lower case letters to name proprietary files, in breach of ISOBUS requirements.
- Multiple enhancements to better handle job data, data imports & exports, etc.
- Multiple changes to improve logic/usability in the User Interface

Matrix® 908 v1.40

August 2023

Associated Documentation:

- Quick Start Guide 98-01586 R2
- User Guide 98-01578 R3
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R6

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

New Features:

- Supports TeeJet Technologies IC45 Sprayer v1.07
- Introduces limited logging of debug data to console memory to aid in troubleshooting some field problems. A USB drive applied app is required to download the data from the console. Use only when specifically requested by TeeJet Technologies Technical Support.

Fixes:

- Corrects the following boundary related problems:
 - The 'GNSS Lost' pop-up would be displayed when closing a boundary if there are many jobs saved on the console.
 - Slow system response when creating, saving, and deleting boundaries if there are many jobs saved on the console.
 - User must acknowledge the delete boundary confirmation twice if deleting a boundary when there are many jobs saved on the console.
 - Boundary creation that includes backing up would sometimes map the boundary to the inside boom tip rather than the outside boom tip.

WARNING! If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service BEFORE updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.

WARNING! Software updates frequently include changes needed to support running changes to internal components in the device. New software is typically backwards compatible to older hardware, but older software often does not work on newer hardware. **DO NOT USE A PREVIOUSLY RELEASED SOFTWARE UPDATE TO ROLL CONSOLE SOFTWARE BACK TO AN EARLIER VERSION.** Contact TeeJet Customer Service or your local dealer for assistance.

WARNING! Several changes have been made to how job data is handled in v1.40 and later. It is **highly recommended** that all jobs created in Matrix 908 v1.31 and prior, including those created in Simple Job Mode, are exported (not simply deleted) from the console before generating new job data with v1.40 or above. Please see the Software Update Instructions bulletin 98-01577 for complete instructions on the process to export all existing job data and update to v1.40 or above.

- The boundary icon does not show in the Menu & Information Bar, and the Job Information & Summary page does not show boundary information if a new boundary is created while there are many jobs saved on the console.
- Console may stop responding when deleting a boundary if there are many jobs saved on the console.
- After closing a boundary on a console that has many jobs saved on it, the “Device has finished loading” pop-up was sometimes displayed, and the user had to restart the system.
- Corrects problem where the user may not be able to close a job if there are many jobs saved on the console.
- Corrects problem where changing the active device in Device Manager did not result in the newly selected device showing as active when first viewed again in Device Manager.
- Corrects problem where the guidance width after a power cycle sometimes reverts to an older value rather than the value most recently set.
- Corrects problem where the Distance-to-axle and Distance-to-boom dimensions for a trailed Application Mapping Device may not be saved correctly when the device is first created.
- Corrects problem where a Vehicle profile sometimes did not save correctly if the hitch type was the only parameter changed in the profile.
- Enforces rule where an existing Field Name cannot be used for a new job, nor can a Field Name be edited to be the same as an existing Field Name. Multiple jobs in the same field should be done using the ‘Copy Job’ function.
- Corrects problem where changes to a Field Name were not saved correctly.
- Corrects problem where it was not possible to switch between saved vehicle profiles if a FieldPilot® Pro or UniPilot® Pro was connected to the system.
- Corrects problem where boom widths reported by third-party ISOBUS Control Functions as DDI 70 (Maximum Width) were reported as zero widths in Device Manager, resulting in ASC and application control not working.
- Corrects problem where the GNSS receiver had to be generating position data before receiver status (Receiver Type, Version, Model, etc.) would be displayed.
- Corrects problem where the name given to an Application Mapping or TeeJet CAN device was not captured in the ISOXML export therefore was not available when the task was imported into an FMIS.
- Corrects problem where TeeJet proprietary Coverage and As-Applied binary files were not deleted from the TASKDATA folder when the associated Task was deleted.
- Corrects problem where exporting jobs from a console where some jobs had previously been deleted resulted in the jobs being correctly loaded onto the USB drive but errantly also remaining on the console.
- Multiple changes to the User Interface, translations, and system architecture to improve functionality and ease-of-use.

Matrix® 908 v1.31

April 2023

Associated Documentation:

- Quick Start Guide 98-01586 R2
- User Guide 98-01578 R3
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R4

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

New Features:

- Introduces a new ‘Minimum Boundary Settings’ mode where mapping of small field objects like those found on golf-courses is more accurate. This mode is enabled by a USB drive app and is not suitable for regular agricultural applications.
- The Job Summary Details page now shows 4 decimal places for Total Arable Land, Exterior Boundary Area, Interior Boundary Area, & Total Applied Area.
- The Area Bounded popup dialog now displays 4 decimal places for both Interior and Exterior boundaries.

Fixes:

- Corrects problem where it was necessary to establish vehicle heading at the start of every job. If there are no changes in the Vehicle or Device during a session, Vehicle heading only needs to be established before opening the first job in each session.
- Corrects problem where the ‘In-Line Distance to Antenna’ and ‘Lateral Distance to Antenna’ values entered in the very first vehicle created on a new console were not saved until the vehicle configuration was edited and saved again.
- Corrects problem where the system would errantly display the pop-up “Bad GNSS signal quality. Cannot start mapping. GNSS signal quality is bad.” when trying to start mapping a boundary immediately after opening a job and stationery.

WARNING! *If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service BEFORE updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.¹*

WARNING! *Software updates frequently include changes needed to support running changes to internal components in the device. New software is typically backwards compatible to older hardware, but older software often does not work on newer hardware. **DO NOT USE A PREVIOUSLY RELEASED SOFTWARE UPDATE TO ROLL CONSOLE SOFTWARE BACK TO AN EARLIER VERSION.** Contact TeeJet Customer Service or your local dealer for assistance.*

¹ Updated for clarity August 2023

- Corrects problem where copied jobs could not be manually named by the user.
- Corrects problem where sometimes when a boundary was closed there would be a duplication of icons in the Status Bar.
- Corrects problem where an Exterior boundary had to be created before an Interior boundary could be saved within the Exterior boundary. Now boundaries can be created in any order.
- Corrects problem introduced in v1.30 where non-default mapping locations were not deployed correctly in jobs or saved correctly through power cycles. Note: non-default mapping locations are unique to the vehicle they are created for.
- Corrects problem where the warning to not autosteer in reverse was displayed on all AutoSteer systems at job start. Now the warning is only displayed when the system has a pivoting hitch.
- Multiple changes to the User Interface to improve functionality and ease-of-use.

Matrix® 908 v1.30

February 2023

Associated Documentation:

- Quick Start Guide 98-01586 R2
- User Guide 98-01578 R3
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R4

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

New Features:

- Supports the creation and saving of multiple Vehicle profiles
- Guidance Width resolution when operating in Metric units (only) has been changed from 0.1 m (10 cm) to 0.01 m (1 cm)
- Area values reported in the popup shown after closing a boundary and in the job summary page now have 2-decimal place resolution
- The prefix 'Job:' has been appended to the beginning of the job name displayed in Job Manager and in the Menu and Information Bar, to help distinguish an auto-named job from the current date and time.
- Adds audio feedback when enabling/disabling ASC by pressing the vehicle chevron or using the Status Detect switch
- The GNSS Heading Filter Strength default value has been changed from 3 to 5
- GNSS status information has been added to the About Page, and the GNSS Receiver serial number is now included with the rest of the GNSS Receiver information on the About Page and the GNSS Status Information page. Displaying the serial number makes it easier to initiate receiver upgrades and TerraStar® subscriptions.
- ¹Supports the following Section Driver Module (SDM)/Smart Cable part numbers:
 - Rauch SmartCable 78-05090 v10.01 as used in kit 90-02980
 - Bogballe SmartCable 78-05082 v5.57

Fixes:

- Corrects problem where the ASC Delay Timer values (DDI 205 & 206) sent by some ISOBUS Control Functions while in a job were not executed unless power was cycled to the system.
- Changed the minimum backlight brightness level to a significantly lower brightness to reduce glare and make night-time operation more comfortable
- Corrects problem where the keyboard did not support Cyrillic options when the language was set to Ukrainian
- Significant reduction in component noise from the console when the backlight is at higher brightness levels
- Multiple changes to the User Interface to improve functionality and ease-of-use.

WARNING! If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service **BEFORE** updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.¹

WARNING! Software updates frequently include changes needed to support running changes to internal components in the device. New software is typically backwards compatible to older hardware, but older software often does not work on newer hardware. **DO NOT USE A PREVIOUSLY RELEASED SOFTWARE UPDATE TO ROLL CONSOLE SOFTWARE BACK TO AN EARLIER VERSION.** Contact TeeJet Customer Service or your local dealer for assistance.

¹ Updated for clarity August 2023

¹ Addendum to new features. Added April 2023.

Matrix® 908 v1.20

September 2022

Associated Documentation:

- Quick Start Guide 98-01586 R2
- User Guide 98-01578 R2
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R3


NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

New Features:

- User Interface/User Experience changed to a card-based system similar to that used in many consumer electronic devices. This makes navigation through the console menus more intuitive, and faster.
- Support for single product prescription map-based applications when connected to supported ISOBUS rate controllers.
 - An unlock is required for Prescription capabilities.
 - Single product/single product blend only
 - Supported prescription file type is ISOXML only, compliant to ISO 11783-10 Version 4.
 - TeeJet Engineering must work with the FMIS developer to create an FMIS export template that assures a TeeJet compatible ISOXML prescription map export from the FMIS.
 - Importing an ISOXML file into the Matrix 908 console will delete all existing jobs on the console and replace them with the imported job(s).
 - Exporting an ISOXML file from the Matrix 908 removes all existing jobs from the console.
- Supports TeeJet IC45 v1.00 & v1.02 and IC18 Sprayer v2.03
- Supports UniPilot® Pro demo mode.
- Increases the size of the UT data mask and softkeys
- Supports the TeeJet proprietary CAN speed message on the TeeJet bus. Commonly used for CAN speed for connected Radion consoles and similar Automatic Section Control devices.
- Introduces an unlock code that is required for spreader configurations with more than two booms on Application Mapping and TeeJet CAN (SDM-type) devices. There may be a charge for the unlock code. When connected to an ISOBUS spreader controller with more than 2 booms a Spreader unlock for the Matrix 908 is not required and the spreader controller manages any unlock implications related to the number of booms.
- Added an 'all sections are the same width' feature to Device setup to reduce the number of steps to create a new device when all sections are the same width.

Fixes:

- Multiple changes to increase system robustness and eliminate problems where the console may stop responding to operator input while setting up vehicles & devices, making changes to connected device settings in the UT, when viewing the GNSS Stats page, and during power-up and/or power-down.
- Corrects problem where the on-screen guideline and guidance prompts were not accurate for the Guidance width set by the operator when operating in Dynamic Adaptive Curve guidance mode.
- The maximum value for the Heading Smoothing filter has been increased from 5 to 10 so that coverage data is smoother on machines operating on rough surfaces and/or when there is a large backset to the boom.
- Corrects problem where the export of (all) jobs from a console with a large number of jobs and job data successfully moves the jobs to the USB Drive but it fails to remove the jobs from Job Manager.
- Corrects problem where the Device Details summary page is not populated correctly if the device has an odd number of boom sections and 5 or more boom sections
- Corrects problem where after running correctly for a period the console may show that the Control function (e.g., IC35, IC45) has disconnected and reconnected again.
- Corrects problem where the connection of a new implement ECU (e.g., IC35, IC45) that is in an alarm state when the Device Review is completed may cause the console to stop responding.
- Corrects problems where it was not possible to set all the digits of a minimum value setting for a device connected to the UT, if the minimum is already set to > 0.
- Corrects problem where it was not possible to enter decimal places in the setup parameters for a device connected to the UT if the localization uses commas for the decimal separator.
- Corrects problem where the Applied Rates or Coverage data layer does not update when first switching between the two layers.

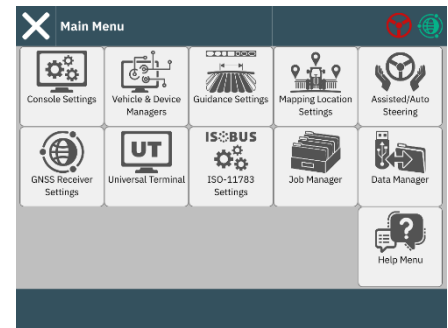

WARNING! If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service BEFORE updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.¹

¹ Updated for clarity August 2023

- Improved logic in the boundary mapping feature to better handle cases where the Position Quality falls below the user set requirement.
- Corrects problem where the Total Application Width shown on the Device Details page sometimes did not round correctly when operating in US units.
- The Slider used to adjust settings such as Volume & Brightness is significantly improved making coarse and fine adjustments fast and accurate.
- Ball-and-Bar toggle controls in setup functions have been changed to check boxes to make setting changes easier, and some labels have been changed to make the purpose of the setting clearer.
- User is prevented from moving to the 'next section' page unless data for the existing section page has been entered.
- Corrects problem where it was not possible to exit out of a settings list without selecting the current setting again, or an alternate setting.
- Corrects problem where the Station ID reported in the GNSS Stats page for TerraStar®-L and TerraStar®-C PRO were reported as '0'. Now reported as 'TSTL' and 'TSTR' respectively.
- Corrects problem where the last mapping location could not be deleted.
- Increased font size for better readability on setup screens and slide-out menus.
- Adjusted colors for better readability on setup screens and slide-out menus.

Matrix® 908 v1.11

March 2022

Associated Documentation:

- Quick Start Guide 98-01586 R1
- User Guide 98-01578 R1
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R1

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

Matrix 908 has built-in ISOBUS TECU functionality and is currently not compatible with ISOBUS systems that already include a TECU e.g. an ISOBUS equipped tractor.

Fixes:

- Corrects problem where the system may stop responding while reviewing or making changes to device configurations.
- Corrects problem where the system may stop responding while changing ISOBUS UT numeric input values.

Matrix® 908 v1.10

January 2022

Associated Documentation:


- Quick Start Guide 98-01586 R1
- User Guide 98-01578 R1
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R1

New Features:

- New Languages: Bulgarian, Czech, Danish, Greek, European Spanish, French, Hungarian, Italian, Latvian, Dutch, Romanian, and Ukrainian
- Feature Unlock
 - ISOBUS Basic – unlocking allows the Matrix 908 to operate as a Universal Terminal (UT) for supported TeeJet devices only (at this time). Unlock codes can be entered in the User Interface.
- TeeJet DynaJet® IC7140 v1.21 support through Universal Terminal (UT)
- ISOXML file support.
 - Importing an ISOXML file will replace existing jobs with the imported jobs. Existing job data will be lost.
 - Prescription maps are not supported.
 - Exporting an ISOXML file removes all existing jobs from the console.
 - Exported data will include geo-referenced coverage and job summary data. Jobs using a supported ISOBUS rate controller will include geo-referenced rate data.
- Customizable Lookahead time – user can set the lookahead time that is applied when manual guidance is being used

WARNING! If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service BEFORE updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.¹

¹ Updated for clarity August 2023

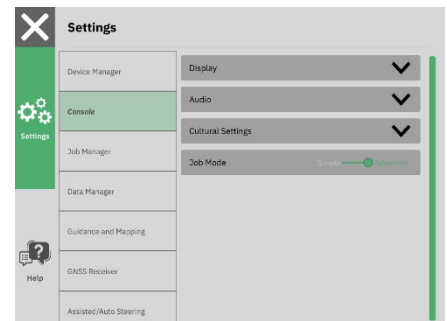

- Accumulated AutoSteer Nudge Offset Distance option added for display on Guidance Bar for systems with FieldPilot® Pro/UniPilot® Pro
- Section Driver Module (SDM) support for SDM v1.02, v2.03, v3.01, & v4.01
- Screenshot function captures screen images to a USB Drive
- TeeJet ISOBUS Boom switchbox 78-00052 support. Note: this switchbox works with compatible TeeJet ICxx rate controllers only.

Fixes:

- Corrects problem where GNSS coordinates with negative Latitude and negative Longitude values prevented jobs from being run
- Corrects for situations where boundaries and coverage maps can have jagged edges when operating on uneven terrain by using a user-adjustable filter on the heading data
- Corrects problem where the booms on a pivoting hitch device may not be correctly positioned behind the vehicle when resuming forward movement after being stopped
- Corrects problem where the console may stop responding when in a job or when viewing the GNSS Stats page
- Corrects problem where the area reported in the pop-up message when closing a boundary may not be accurate for the boundary just completed
- Corrects problem where the boom graphics in the Guidance page could be errant if the boom configuration is changed without following the reconfiguration with a power cycle
- Corrects problem where the Universal Terminal (UT) Data Mask may flash (momentarily go blank) while in a job. This behavior was most prevalent with systems containing an IC35 and DynaJet® IC7140.
- Corrects problem where device boom sections were sometimes errantly turned on again after first being turned off at the close of a job
- Corrects problem where device boom sections momentarily turned on when a job was opened while the vehicle was moving
- Corrects problem where lateral antenna offsets were being applied twice on systems that included an SCM Pro for UniPilot® Pro/FieldPilot® Pro.
- Corrects Guideline placement based on Autosteer availability
 - The Guideline is now centered on the boom (previously centered on the Pivot Point), for vehicles that do not have UniPilot® Pro/FieldPilot® Pro; and Cross-Track Error is based on the same boom position
 - Vehicles with UniPilot® Pro/FieldPilot® Pro still guides/displays Cross-Track Error based on the Pivot Point.
- Prevents user from creating a boundary when the GNSS quality does not meet the Position Quality Requirement specified by the user
- Corrects problem where there was a high-frequency flicker in the display
- Prevents the user from creating an Autosteer vehicle profile name that starts with a number. Autosteer profile names must start with a non-numeric character
- Corrects problem where SCM Pro Tilt corrected GNSS position data was being used when the Public Liability Disclaimer Notice for UniPilot® Pro/FieldPilot® Pro had been declined by the user
- Prevents the user from attempting to close an Interior Boundary or Exterior Boundary that is smaller than the minimum allowed (25 m2)
- Reorganized and clarified Help-> About page
 - SCM Pro version information moved from Assisted/Auto Steering page
 - Updated the software component names listed under Software and Firmware Version Information to user-friendly names
 - Includes SDM version
 - Disk Space Remaining value limited to whole numbers (integer)
- Multiple changes to the user interface including headings, pop-ups and text strings to improve appearance, visibility, night mode operation, and better handle language options
- Removed the Automatic Section Control (ASC) toggle from the Quick Adjust menu
- Removed the Layers button from the Feature Bar for devices that do not utilize the Layers functionality
- Corrects inconsistency in the number of decimal places displayed between the values displayed in the Guidance bar and the values displayed in the user selection cards for the Guidance Bar
- Corrects problem where the GNSS receiver would be configured when entering the GNSS settings page

WARNING! If your system uses an ISOBUS device and the console is at v1.00/v1.01/v1.02, contact your local dealer or TeeJet Customer Service **BEFORE** updating your console. After updating a v1.00/v1.01/v1.02 console to v1.10 or above, an unlock code will be required to access the Universal Terminal (UT) feature.¹

¹ Updated for clarity August 2023

Matrix® 908 v1.02

October 2021

Associated Documentation:

- Quick Start Guide 98-01586 R1
- User Guide 98-01578 R0
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R0

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

Matrix 908 has built-in ISOBUS TECU functionality and is currently not compatible with ISOBUS systems that already include a TECU e.g. an ISOBUS equipped tractor.

Fixes:

- Corrects problem where translations for AutoSteer options do not appear

Matrix® 908 v1.01

September 2021

Associated Documentation:

- Quick Start Guide 98-01586 R1
- User Guide 98-01578 R0
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0
- Software Update Instructions 98-01577 R0

NOTES: If a feature is not explicitly stated in this or previous release note documents it is not currently supported by Matrix 908.

Matrix 908 has built-in ISOBUS TECU functionality and is currently not compatible with ISOBUS systems that already include a TECU e.g. an ISOBUS equipped tractor.

New Features:

- Advanced Job Mode
 - Multiple jobs can be created, custom named, saved, appended, and deleted
 - Boundaries and guidelines from an existing job can be copied into a new job so a user can easily use them when running a new operation in the same field
- Support for a single Section Driver Module (SDM) or device that emulates an SDM (ex: Radion 8140)
- New Languages: Polish, Central/South American Spanish, Brazilian Portuguese, US English, and German
- Job Details from the Status Bar – press the Job Name in the Status Bar to provide access to:
 - Total Arable Land
 - Exterior Boundary Area
 - Number of Exterior Boundary Polygons
 - Interior Boundary Area
 - Number of Interior Boundary Polygons
 - Total Applied Area
- Status switch direct input into console can be used to:
 - Turn Applied Alert Device mapping ON/OFF (no SDM), or:
 - Toggle ASC between Auto and Manual when the system has an SDM
- Customizable boundary names
- Customizable mapping location for mapping boundaries
- AutoSteer status messages added to the Status Bar
- Support for 4-wheel steering (4WS) mode.

NOTE: 4WS support is strictly limited to OEM applications. Generic retrofits on 4WS machines are not supported.

- QR codes for links to Product Registration web pages
- QR codes for links to the User Guide
- Pop-up message if user enters a job before the discovery process for SCM Pro (UniPilot® Pro and FieldPilot® Pro) has completed
- Display of the SCM Pro version in the User Interface
- Pop-up message when GNSS is lost, or the Quality Indicator is below that required to meet the Position Quality Requirement setting
- ISO 11783 File Server functionality

Fixes:

- Changed the range of the AutoSteer Nudge function to 1"-18" / 1 cm - 50 cm with defaults of 4" / 10 cm
- Dynamic Adaptive Curve guidelines are now retained in the job through power cycles
- Corrects problem where GLONASS & QZSS constellations were not enabled by default in new consoles.

NOTE: users updating from v1.00 will need to manually turn these constellations on in Settings-> GNSS Receiver-> Advanced Settings

- Corrects problem where the last mapped boundary could not be deleted
- Corrects problem where the vehicle chevron and the boom on a fixed mount device were not shown in the correct location when travelling in reverse
- Corrects problem where the guidance directional arrows in the Guidance bar were sometimes not being displayed
- System now defaults to Straight A-B guidance mode when starting a new job
- Changed the default overlap % in the Device Wizard to 100%

- Device Wizard graphics for the Delay On & Delay Off times are now more intuitive
- Pop-up warning is displayed if user tries to close a job that has an unfinished boundary
- Corrects problem where the direction of an AutoSteer Nudge was not displayed to the user
- Corrects problem where AutoSteer would not disengage if an uncommon circumstance resulted in a new guideline instantly becoming the active guideline while AutoSteer is engaged
- Corrects problem where the Device Wizard would allow the user to enter Delay On and Delay Off values < 0.2 sec. but the system would save them as 0.2 sec. 0.2 sec. is the minimum required for correct system operation, and the values can now only be set to 0.2 sec. or higher
- Corrects problem where the Device Wizard would sometimes require a power cycle and second confirmation that the target device it is to be the active device
- Corrects problem where systems with a single frequency GNSS receiver would sometimes errantly list TerraStar®-L as a Position Quality Requirement option
- Corrects problem where the icons in the action bar did not change to white when night mode is active
- Corrects problem where the system would errantly display a 'Calibration Aborted' pop-up message after successfully completing a stand-alone Tilt or Wheel-Angle Sensor calibration
- Corrects problem where it was sometimes possible to open a job that is further away than the current UTM zone or either UTM zone adjacent to the current UTM zone
- Corrects problem where the system would stop responding if a perfectly straight guideline was created when set to Dynamic Adaptive Curve guidance mode
- Multiple changes to headings and text strings to improve appearance and better handle language options
- Corrects problem where some pages could be dragged left or right when not appropriate

Matrix® 908 v1.00

June 2021

Associated Documentation:

- Quick Start Guide 98-01586 R1
- Product Registration Bulletin 98-01585 R0
- North America Warranty & Registration Bulletin 98-01587 R0

NOTE: If a feature is not explicitly stated in this document it is not included in this release.

Key Features and Benefits:

- Global first Release of v1.00 software for Matrix 908 console
- Manual Guidance Modes
 - Straight A-B
 - Dynamic Adaptive Curve
 - Guideline is not retained through power cycle
 - Circle Pivot
 - Azimuth
- Internal expandable GNSS receiver with multi-constellation dual frequency RXA-52 antenna
 - Base units are single frequency supporting GPS, GLONASS, & QZSS constellations
 - Upgrade options to add:
 - Galileo constellation
 - Galileo & BeiDou constellations
 - Dual Frequency
 - Dual Frequency & TerraStar®-L (subscription required)
 - Dual Frequency & TerraStar®-C PRO (subscription required)
- Assisted/Automatic Steering
 - Supports FieldPilot® Pro Hydraulic Steer Vehicle kits and UniPilot® Pro vehicles
 - Requires SCM Pro v5.2.34851 (upgrade details coming soon)
 - FPP/UPP kits for Matrix GS/Aeros will require additional adapter cables to operate w/ Matrix 908 (details coming soon)
 - Includes a Nudge function for Straight A-B & Azimuth Guidance modes
- TwinView mode splits the screen simultaneously displaying Vehicle View or Field View with the UT View
- Boundaries – Internal & external boundaries supported
- Simple job mode without job reports
- Supported device applications
 - Applied Area Alert Device
 - Straight boom sprayer
 - Spreader
 - TeeJet ISOBUS controllers with Automatic Section Control
 - IC35 v1.00

- IC38 v2.00e
- Automatic Section Control (ASC) operation at 10 Hz
- Vehicle model supports
 - Fixed mount implements
 - Trailed (pivoting hitch) implements
- Reverse Sense input (5V-12V) directly into console (product application while in reverse is not supported)
- Localization options:
 - English & Russian languages
 - US & Metric units
 - Local Time Zone
- Application Rates [As-Applied Rates] map layer
 - Overall range of application rates is divided into 10 groups
 - Each group is mapped using a solid color selected from an associated color gradient set